


Connections

Thread union in T form, GVS-T


FEZER
Simply move more.



GVS-T

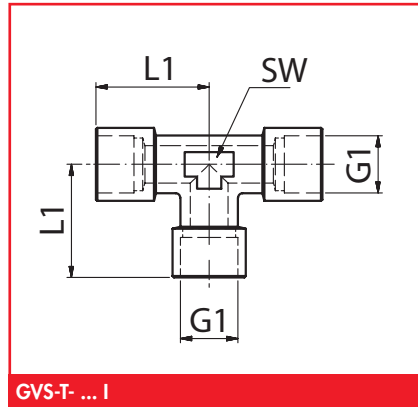

GVS-T ... I

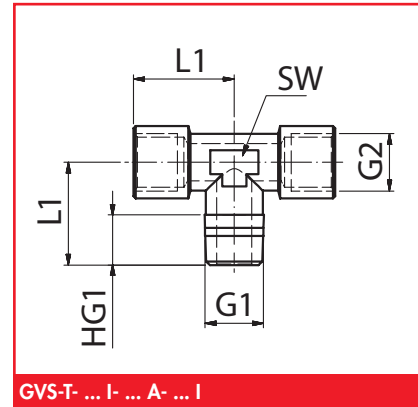

GVS-T ... I ... A- ... I

Article number

| Type | | Weight (kg) |
|----------------------|-------------|-------------|
| GVS-T-1/8I | 6.21.5.0828 | 0,020 |
| GVS-T-1/8I-1/8A-1/8I | 6.21.5.0830 | 0,030 |
| GVS-T-1/4I | 6.21.5.0416 | 0,040 |
| GVS-T-1/4I-1/4A-1/4I | 6.21.5.0657 | 0,040 |
| GVS-T-3/8I | 6.21.5.0829 | 0,050 |
| GVS-T-3/8A-3/8A-3/8I | 6.21.5.0831 | 0,050 |
| GVS-T-1/2I | 6.21.5.0636 | 0,100 |
| GVS-T-1/2A-1/2A-1/2I | 6.21.5.0832 | 0,070 |

Dimensions

| Type | L1 | G1 | G2 | HG1 | SW |
|----------------------|------|------|------|------|----|
| GVS-T-1/8I | 19 | G1/8 | G1/8 | 8,5 | 12 |
| GVS-T-1/8I-1/8A-1/8I | 19 | G1/8 | G1/8 | 8,5 | 12 |
| GVS-T-1/4I | 23 | G1/4 | G1/4 | 11 | 13 |
| GVS-T-1/4I-1/4A-1/4I | 23 | G1/4 | G1/4 | 11 | 13 |
| GVS-T-3/8I | 25 | G3/8 | G3/8 | 11,5 | 16 |
| GVS-T-3/8A-3/8A-3/8I | 25 | G3/8 | G3/8 | 11,5 | 16 |
| GVS-T-1/2I | 31,5 | G1/2 | G1/2 | 14 | 20 |
| GVS-T-1/2A-1/2A-1/2I | 31,5 | G1/2 | G1/2 | 14 | 20 |


Connections

Thread union in TW form, GVS-TW

FEZER
Simply move more.



GVS-TW

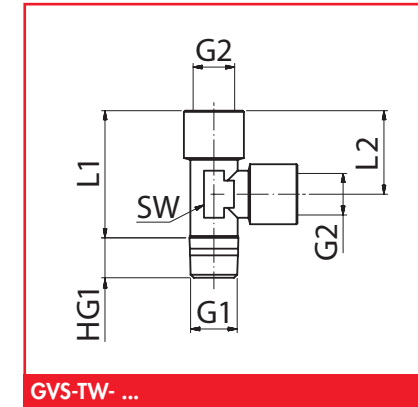

GVS-TW- ...

Article number

| Type | | Weight (kg) |
|-----------------------|-------------|-------------|
| GVS-TW-1/8I-1/8I-1/8A | 6.21.5.0860 | 0,022 |
| GVS-TW-1/4I-1/4I-1/4A | 6.21.5.0861 | 0,037 |
| GVS-TW-3/8I-3/8I-3/8A | 6.21.5.0862 | 0,049 |
| GVS-TW-1/2I-1/2I-1/2A | 6.21.5.0863 | 0,089 |

Dimensions

| Type | L1 | L2 | G1 | G2 | HG1 | SW |
|------------------|------|------|------|------|------|----|
| GVS-TW-1/8A-1/8I | 28,5 | 19 | G1/8 | G1/8 | 8,5 | 12 |
| GVS-TW-1/4A-1/4I | 35 | 23 | G1/4 | G1/4 | 11 | 13 |
| GVS-TW-3/8A-3/8I | 37 | 25 | G3/8 | G3/8 | 11,5 | 16 |
| GVS-TW-1/2A-1/2I | 45,5 | 31,5 | G1/2 | G1/2 | 14 | 20 |